


AG 360 Handle Proximity Sensor Bracket Change

This bulletin is to inform distributors that the original bracket for the handle proximity switch on the AG-360 has been re-designed. The original routing hole size for the proximity sensor cord was increased to help prevent the cord from pinching in the handle during operation. Any machine that shipped after the issue date of this bulletin has the corrected bracket already installed. Any machine that shipped prior to this date may have the original bracket. The new bracket mount is drawing number 1026203.

New Bracket

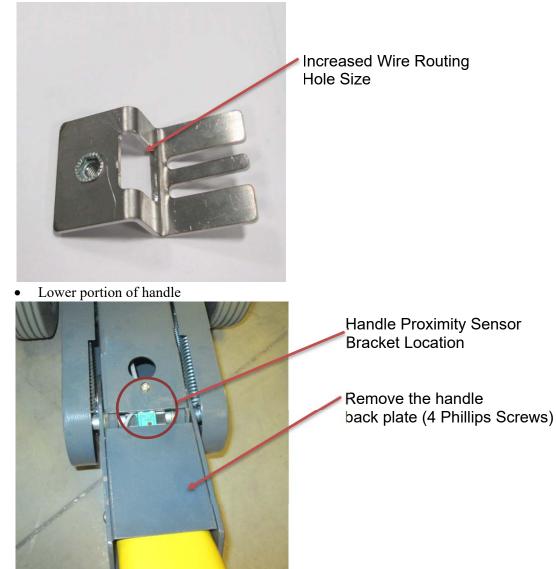

Orion Packaging Systems * A division of Pro Mach 4750 County Road 13 NE Alexandria, MN 56308 (800) 333-6556 * *www.support.orionpackaging.com Page* **1** of **2**



• Remove the Allen screw from the proximity sensor bracket.



- Remove the two Phillips screws that attach the proximity sensor to the original bracket and backplate.
- Using the same two screws, attach the proximity sensor to the new bracket and backplate.



- Re-attach the proximity sensor bracket.
- Re-attach the handle back plate.

Orion Packaging Systems * A division of Pro Mach 4750 County Road 13 NE Alexandria, MN 56308 (800) 333-6556 * *www.support.orionpackaging.com Page* **2** of **2**